



HOME INSPECTION

08/28/18

5432 Test Ave

St. Louis, MO 63139

We love your home.





HOME INSPECTION

08/28/18

5432 Test Ave

St. Louis, MO 63139

We love your home.





Prepared with care for Denny Exampleson

Property address 5432 Test Ave St. Louis, MO 63139



OUR SERVICE COMMITMENT

Our reputation is built on decades of honesty, integrity and excellent service to our customers at one of the most important decisions in their lives – buying or selling a home. We are committed to ensuring that each of our customers enjoys an exceptional inspection experience.

Post Inspection Customer Service 877.211.5723

Schedule Your Next Inspection 888.USINSPECT

Rate Us!

https://www.yelp.com/st-louis



HVAC Air Filters First shipment free See last page



FIRST TIME HOME BUYER



Congratulations on your prospective new home!

As a first-time homebuyer, we understand that you may not have had the pleasure of participating in a real estate transaction or a home inspection. Having served thousands of first-time homebuyer customers, we understand your journey. We're aware that you may be anxious.

Never fear! Trust your Realtor to take exceptional care of you. And trust our inspector, who knows that you may need extra special care and attention. We're excited about helping you to understand how to best manage your new home.

With that in mind, this report is tailored to first-time homebuyers. Because a home may be the biggest investment you'll ever make, it's important to pay careful attention to our tips and hints about how to maintain your home. Therefore, whenever you see _____, read our helpful comment that our inspector wants you to know about your prospective new home.

Once again, congratulations and thank you for including us in your journey. We're honored to deliver the industry's finest inspection and report to you as part of your new home search.



Of 5+ million homes sold anually in the United States, approximately 1/3 are sold to first-time homebuyers!



PRINT, SNIP, AND PLACE INSIDE YOUR KITCHEN CABINET!



Location of your WATER shut-off valve Basement



Location of your GAS shut-off valve **Basement**



Location of your ELECTRICAL Panels Basement

Number of HVAC AIR FILTERS

Sizes(s) of HVAC AIR FILTERS 16x25x1

CHANGE your HVAC filters QUARTERLY! Go to www.filtereasy.com/usinspect for free HVAC air filters SERVICE your HVAC system semi-anually!





TABLE OF CONTENTS

Objectives and Scope	06
General Information	07
Definition of Terms	08
Graphical Summary	09
Narrative Summary	10
Property Photos	12
Property Components and Photos	
Exterior	13
Roof	18
Structure	21
Water Control	24
Insulation and Ventilation	25
Interior	26
Electrical	29
Heating and Cooling	32
Plumbing	35
Fuel Services	38
Appliances	39
HVAC Air Filters - First Shipment Free	40
Seasonal Maintenance Checklist	41
System and Component Life Expectancies	42



OBJECTIVES AND SCOPE

This document is a home inspection report designed to assist a buyer, seller or homeowner to evaluate the condition of a home, as well as its immediate surrounding areas, at a specific date and time.

The inspector conducts an evaluation of the home and permanently-installed, readily-accessible systems and components.

The inspection is limited in scope.

The inspection is not intended to be an exhaustive evaluation of a home, systems or components. The inspector does not disassemble equipment, dismantle items, move furnishings or stored items, lift floor coverings, open walls, or disturb items which belong to the occupant(s). The inspector may not specifically address every component in the home, e.g., numerous items such as windows, electrical outlets and light fixtures may be randomly selected and evaluated. The inspector does not evaluate items that are inaccessible, concealed or underground. Therefore, the home or property may have issues that cannot be discovered by the inspector. For more information, please refer to Limitations and Exclusions in our Inspection Services Agreement.

The inspection addresses visible and apparent conditions which exist at the date and time of the inspection.

The inspector endeavors to identify and accurately report on visible issues which affect the construction, general maintenance, and overall safety of the home and its immediate surrounding areas. Conditions may change, perhaps dramatically, between the date and time of the inspection and the date and time of settlement and/or move-in.

The inspection report reflects observations and opinions of the inspector.

Subsequent inspections or evaluations performed by other parties may yield different, and in some cases, contradictory findings. There can be several reasons for discrepancies in findings, including the interval between inspections, differences in the objectives or scope of each inspection, and background, training, and subjective opinions and experiences of the individuals performing an inspection.

The inspection does not eliminate all risks involved in a real estate transaction.

The inspection does not anticipate subsequent events or changes in performance of the home due to changes in use or occupancy. We recommend that you obtain information which is available about the home and property, including seller's disclosures, previous inspection reports, engineering reports, building permits, remodeling permits, and reports delivered for or by municipal inspection departments, lenders, relocation companies, insurers, and appraisers. You should also attempt to determine whether repairs, renovation, remodeling, additions, or other such activities have occurred.

The inspection is not a code inspection.

The inspection may address issues which refer to a particular code but the inspector does not conduct a code compliance inspection or code safety inspection, and does not verify compliance with manufacturer's installation instructions for any system or component. We are not authorized to regulate or enforce code compliance, and must instead operate under the reasonable presumption that the home is compliant with all code requirements. Please contact the relevant government authority or original equipment manufacturer for information related to construction, addition or remodeling permits, energy efficiency ratings, or other issues relating to code compliance.



GENERAL INFORMATION

CLIENT

Name Denny Exampleson

E-mail

INSPECTOR

Name Mr. Inspector

E-mail Inspector@usinspect.com

License

INSPECTION DETAILS

Property type Single Family

Year built 1902
Approximate square feet 1090
Inspection date 08/28/18
Inspection start time 10:30AM
Temperature (F) 92
Weather (today) Clear

Weather (yesterday)

Direction in which home faces

Parties present at start of inspection

Clear

North

Buyer

Buver's Realtor

Other

Occupied Occupied

Directions referred to in this report (i.e. left side, rear, etc.) assume you are facing the home from the front. Please note that this inspection does not include any research on the property's permit history.

LIMITATION

Storage/personal items restrict access to various interior components; therefore, the inspection of such components is limited.

INFORMATION

The inspector scanned the interior floors, walls, and ceilings of the home with an infrared camera. The infrared scan did not detect any significant defects at the time of the inspection. When systems are functional, and prior to conducting the scan, the HVAC system(s) are operated to increase the temperature differential between the interior and exterior of the home. This aids in the detection of reportable defects such as roof leaks, plumbing leaks, exterior water intrusion, etc.

As the prospective owner of an older home, one should understand and appreciate the unique characteristics of such ownership. An older home can't be compared with new construction, i.e., the structure probably was constructed with materials and methods no longer used according to local code and industry guidelines which have changed over time. However, construction of an older home is not inferior to new construction; in fact, some aspects of older construction materials and methods are superior to current industry standards. It is not uncommon for an older house to have uneven roof lines and uneven floors due to the nature of the construction, long-term settlement, and age deficiencies. An older home also may reflect a history of construction evolution and modernization, e.g., mechanical systems, kitchen and bathrooms likely have been renovated even if the foundation and structure of the home have remained mostly original. There also are risks with older homes, including chimneys which represent potential fire hazards or materials used in construction which may have been discontinued, including lead paint, asbestos, and potential allergens such as horsehair binder in the plaster; this inspection does not include testing or laboratory analysis of such materials.



DEFINITION OF TERMS

Acceptable	Performs intended function.

Not Present Does not exist in home or on property.

Not Inspected Inaccessible, seasonal impediment, etc.

Safety Issue Serious violation of established safety standards.

Major Concern Structurally unsound, unsafe, and/or inoperative; likely to require significant expense.

Repair Excessively worn, non-functioning, or missing part of a system; corrective action generally is required to ensure proper operation and/or to improve system reliability or condition.

Maintenance Requires maintenance or proactive measures to ensure proper function; corrective action is required to prevent deterioration or the need for more serious repairs in the near future.

Infrared Includes photo captured with infrared camera.





SUMMARY

EXTERIOR

- Oriveway
- **Walks**
- Patio
- Fence
- M Retaining Wall
- Siding
- Trim
- Chimney
- O Doors
- Stairs/Steps
- Stoop
- Porch
- Garage Vehicle Door
- Garage Vehicle Door Opener
- Carport

ROOF

- Covering
- **♥** Flashing
- Skylight

STRUCTURE

- Foundation
- Beams
- ♥ Piers/Posts
- Floor
- **Wall**
- Roof
- Roof Sheathing
- Attic Access
- Crawl Space Access

WATER CONTROL

- Gutter/Downspout
- O Drain
- Window Well
- Sump Pump

INSULATION AND VENTILATION

- Attic Insulation
- Basement Insulation
- Crawl Space Insulation
- Ventilation
- Humidity Control

INTERIOR

- **♥** Floors
- M Walls
- Ceilings
- Cabinets
- Countertops
- **V** Doors
- Windows
- **▼** Fireplace
- Fireplace Damper
- Fireplace Doors/Screens
- Fuel-burning Appliances

ELECTRICAL

- Service
- Panel
- Sub-Panel
- Branch Circuits
- ✓ Grounding/Bonding
- ▼ Receptacles
- Switches
- Fixtures
- Smoke Detectors
- **O** CO Detectors

HVAC

- ✓ Heating System
- M Cooling System
- Distribution
- Humidifier
- ▼ Thermostat

PLUMBING

- Service
- Main Shut-off
- Supply Pipes
- Orain, Waste, Vents
- Toilet
- √ Tub/Shower
- Sink
- Water Heater
- Whirlpool Tub
- Hose Faucet

FUEL SERVICES

- Tanks
- Meter

APPLIANCES

- Range/Oven
- Oven
- Microwave
- Cooktop
- **♥** Garbage Disposal
- Dishwasher
- Refrigerator/Freezer
- Other Built-ins
- Ventilation System
- Washer
- Dryer



SUMMARY OF ISSUES

	MAJOR CONCERN	Page
	Roof - Covering 1	
01	The roof covering is old, worn, and deteriorated. Repairs would not be practical or reliable. Location: Main roof. <i>Replace the roof.</i>	<u>19</u>
	SAFETY ISSUE	
	Exterior - Stairs/Steps	
02	The handrail is missing. This is a safety hazard. Location: Rear. Replace the handrail.	<u>16</u>
	Exterior - Deck/Balcony	
03	The deck's support members lack hanger hardware. This is a safety concern. Location: Rear. Install hanger hardware.	<u>17</u>
	Interior - Stairs/Steps	
04	There are loose steps. This is a safety issue. Location: Basement. <i>Repair or replace the steps</i> .	<u>27</u>
	Electrical - Branch Circuits	
05	There are missing junction box covers. This is a safety concern that defeats the box's fire rating and permits contact with energized components. Location: Basement. <i>Hire a contractor to make required repairs</i> .	<u>31</u>
	Electrical - Smoke Detectors	
06	There are missing smoke detectors. This is a safety issue. There should be at least one functional smoke detector on each level of the house. Location: Bedroom. <i>Replace the smoke detector.</i>	<u>31</u>
	REPAIR	
	Exterior - Siding	
07	There are deteriorated mortar joints in the siding. This permits moisture penetration and will cause further damage. Location: Right Side. <i>Repair the mortar joints</i> .	<u>14</u>
80	There are gaps in the brick just below fromt door near from deck. This permits moisture to enter. Location: Front. Repair the bricks and repair damage which may be revealed.	<u>15</u>
	Exterior - Trim	
09	The paint on the trim is peeling or blistering. This implies that moisture has penetrated behind the finishes. Location: Left side basement windows. <i>Repair or replace the trim and repair any damage which may be revealed.</i>	<u>15</u>
	Roof - Covering 2	
10	The roofing is deteriorated. This permits water penetration. Location: Addition. <i>Hire a roofing contractor to provide repairs or replacement as needed.</i>	<u>20</u>
	Structure - Beams	
11	There is evidence of additional, non-original structural supports and alterations. Add the proper columns to beams. A section of main beam and columns was removed but seems to be stable and uneffected. Location: Basement. Consider hiring a contractor to review and make recommendations but the structure seems stable.	<u>22</u>
	Structure - Floor	
12	The joist is notched or has holes drilled that are beyond acceptable limits. This reduces the joist's load-bearing capacity. Location: Basement near plumbing stack. <i>Hire a contractor to repair or replace the joist.</i>	<u>22</u>
	Plumbing - Supply Pipes	
13	The water supply pipe is corroded. This can cause damage and leaks. Location: Basement near electric panel. <i>Hire a plumber to replace the pipe.</i>	<u>36</u>
	Plumbing - Toilet	
14	The toilet base is loose at the floor. This permits leaks and causes water damage to surrounding areas. Location: Bathroom. <i>Re-secure the toilet to the flooring after replacing the wax ring.</i>	<u>37</u>
	Plumbing - Sink	
15	The sink drain is leaking. This can allow water damage. Location: Bathroom. <i>Repair or replace the drain.</i>	<u>37</u>



SUMMARY OF ISSUES

MAINTENANCE

Exterior - Retaining Wall

16	There is minor movement in the retaining wall. The cause for this should be determined, and repairs made to prevent further movement. Location: Rear. <i>Hire a contractor to evaluate the movement and provide repairs as needed.</i>	<u>14</u>
	Interior - Walls	
17	The interior wall shows some possible past water damaged. Testing with a moisture meter indicates low moisture content (dry) at the time of this inspection. It maybe older and the wall. Wasn't patched. Location: Living Room. <i>Monitor the wall near the front large window for water leaks.</i>	<u>27</u>
	Interior - Windows	
18	The window is painted/stuck shut in the bathroom. Location: Bathroom. Remove the paint to unstick the window.	28
	HVAC - Cooling System	
19	The compressor coils are dirty. This can affect efficiency. Location: Rear. Hire an contractor to clean the coils.	<u>33</u>



PHOTOS





LOTS AND GROUNDS

Driveway Concrete
Walks Concrete
Retaining Wall Masonry
Rear

EXTERIOR

Siding Brick
Chimney 1 Brick
Chimney 2 Brick

Doors Wood, Metal

Deck/Balcony Wood

LIMITATIONS

Retaining Wall Retaining walls are visually inspected for deterioration, leaning or other

signs of failure. Portions of the structural components are below grade and therefore cannot be inspected. Determination of the adequacy of a

retaining wall is outside the scope of a home inspection absent any signs of

failure.

Chimney 1 Visibility and accessibility of the chimney interior is limited. No

determination of the interior condition, lining, or its ability to function safely and properly can be made. Consult a chimney specialist for a

comprehensive evaluation prior to closing as needed.

Chimney 2 Visibility and accessibility of the chimney interior is limited. No

determination of the interior condition, lining, or its ability to function safely and properly can be made. Consult a chimney specialist for a

comprehensive evaluation prior to closing as needed.

INFORMATION

Siding requires periodic maintenance, including cleaning. Add finish (paint or stain) to areas which may become unprotected due to erosion by weather.

All window and door penetrations, siding terminations and trim intersections should be sealed on a routine basis to help prevent water penetration.

Wood trim is subject to deterioration and requires periodic maintenance, including cleaning. Keep trim material sealed with paint or stain to protect it from moisture penetration. Repair and caulk gaps prior to recoating.

COMMENTS

Exterior - Driveway

No issues noted.

Exterior - Walks

✓ No issues noted.

Exterior - Patio

Not present.

Exterior - Fence



Exterior - Retaining Wall

M Issue

There is minor movement in the retaining wall. The cause for this should be determined, and repairs

made to prevent further movement.

Location Rear

Action Hire a contractor to evaluate the movement and provide repairs as needed.



Exterior - Siding



Issue There are deteriorated mortar joints in the siding. This permits moisture penetration and will cause further damage.

Location Right Side

Action Repair the mortar joints.







Issue

There are gaps in the brick just below fromt door near from deck. This permits moisture to enter.

Location Front

Repair the bricks and repair damage which may be revealed. Action



Exterior - Trim



Issue The paint on the trim is peeling or blistering. This implies that moisture has penetrated behind the finishes.

Location Left side basement windows.

Repair or replace the trim and repair any damage which may be revealed. Action





Exterior - Chimney 1



✓ No issues noted.

Exterior - Chimney 2



✓ No issues noted.



Exterior - Doors

✓ No issues noted.

Exterior - Stairs/Steps

♦ Issue The handrail is missing. This is a safety hazard.

Location Rear

Action Replace the handrail.



Exterior - Stoop

Not present.

Exterior - Porch



Exterior - Deck/Balcony

Issue The deck's support members lack hanger hardware. This is a safety concern.

Location Rear

Install hanger hardware. Action



Exterior - Garage Vehicle Door

Not present.

Exterior - Garage Vehicle Door Opener

Not present.

Exterior - Carport



ROOF

COVERING 1

Location Main Structure

Material Single-Ply Modified Bitumen

Age (Years) 8 to 12 Estimated Useful Life When New (Years) 18 to 20

Inspection Method Walked accessible areas

COVERING 2

Location Other

Material Fiberglass Architectural Shingle

Age (Years) 10 to 14 Estimated Useful Life When New (Years) 20 to 25

Inspection Method Walked accessible areas

INFORMATION

Estimated remaining life of roofing is subjective and depends on numerous criteria, which vary by roof and may include the following variables:

- i) direction and exposure to the sun, i.e., the more directly the roof is exposed to the sun, the shorter the roof's life, e.g., south-facing slope generally wears out faster than a north-facing slope;
- ii) slope of the roof, i.e., the higher the slope, the faster water drains off, e.g., higher- sloped roofs generally last longer than lower-sloped roofs;
- iii) color of the roof, i.e., lighter roofs are cooler and generally last longer; color may affect the temperature of the roof surface by as much as 10F to 20F;
- iv) weight of the roof covering, i.e., heavier shingles typically last longer than lighter shingles;
- v) quality of the sheathing, i.e., type and thickness of materials used; and
- vi) attic ventilation, i.e., proper attic ventilation helps to control temperature of the roof during hot weather and is essential to reduce moisture-related sheathing damage.

Estimates of age and remaining life are based on an inspector's experience, as well as numerous assumptions and variables, including the aforementioned variables. Therefore, inspector estimates should be considered a general guide.

Please note that roof leaks often are due to flashing or valley failures. If there are roofing leaks, inspect the flashings or valleys before assuming that damaged or deteriorated roofing material is the cause of the water penetration.

PHOTOS

Roof - Covering 1





ROOF

COMMENTS

Roof - Covering 1

Issue

Issue The roof covering is old, worn, and deteriorated. Repairs would not be practical or reliable.

Location Main roof Action Replace the roof.









ROOF

Roof - Covering 2

Issue The roofing is deteriorated. This permits water penetration.

Location Addition

Hire a roofing contractor to provide repairs or replacement as needed. Action





Roof - Flashing



✓ No issues noted.

Roof - Skylight





STRUCTURE

FOUNDATION

Basement Foundation

Stone

Wood Beams Wood Piers and Posts

Dimensional Lumber Floor

Oriented strand board

Oriented strand board SubFloor

Walls Roof

Roof Sheathing

ATTIC

Access Location Access Type

LIMITATIONS

Some areas are inaccessible and/or not visible due to height, design and Foundation

materials. Therefore, the inspection is limited.

Stored items.

INFORMATION

There are squeaks in the floor framing. Squeaks typically are the result of loose nails or other fasteners pulling in and out of the floor wood frame members, or joists rubbing against the sub-flooring. Squeaks do not constitute a structural deficiency.

COMMENTS

Structure - Foundation



No issues noted.



STRUCTURE

Structure - Beams

Issue

There is evidence of additional, non-original structural supports and alterations. Add the proper columns to beams. A section of main beam and columns was removed but seems to be stable and uneffected.

Location Basement

Consider hiring a contractor to review and make recommendations but the structure seems stable. Action





Structure - Piers/Posts



✓ No issues noted.

Structure - Floor

Issue

The joist is notched or has holes drilled that are beyond acceptable limits. This reduces the joist's loadbearing capacity.

Location Basement near plumbing stack.

Hire a contractor to repair or replace the joist.



Structure - Wall



✓ No issues noted.



STRUCTURE

Structure - Roof

✓ No issues noted.

Structure - Attic Access

✓ No issues noted.

Structure - Crawl Space Access



WATER CONTROL

ROOF DRAINAGE

Gutters and Downspouts Aluminum

Conventional

STRUCTURAL DRAINAGE

Sump Pump Basement

Submersible

Exterior Drain Basement Stairwell

Rear

LOT DRAINAGE

Grading Moderate

LIMITATIONS

Sump Pump The sump pump cannot be fully inspected because it is sealed or covered,

e.g., carpet, rug or other material. This prevents unobstructed access.

Therefore, the inspection is limited.

INFORMATION

The overwhelming majority of water penetration problems is caused by surface water that is not managed properly. Grading which slopes towards the foundation of the home permits water to accumulate at the foundation; poor maintenance of gutter and downspout systems also contributes to water accumulation problems.

Grading around the home should be maintained so that surface water does not accumulate close to the foundation. Grading should slope away from the home at a rate of approximately 1" per 1' for at least 6'.

In order to divert water away from the foundation, soil must be dense and slope away from the foundation. In situations in which regrading is not a reasonable option, an interior hydrostatic pressure relief system with a sump pump may be required.

Keep gutters and downspouts clean and free of debris or obstructions. Gutters which hold water tend to sag, overflow, and may cause water penetration to occur through below grade foundation walls. Homes near trees require more frequent gutter and downspout cleaning to ensure continued proper functionality. Roof gutters should be installed with adequate slope towards the downspouts to allow for proper draining of the gutters. Downspouts should deposit roof water away from the walls of the house with splash blocks or downspout extensions. The grades in the areas where the water is being deposited must slope away from the walls and properly divert water from the house.

Stairwell drains require periodic cleaning. Clogged stairwell drains which overflow can permit water penetration into the home.

COMMENTS

Water Control - Gutter/Downspout

✓ No issues noted.

Water Control - Drain

No issues noted.

Water Control - Window Well

Not present.

Water Control - Sump Pump

✓ No issues noted.



INSULATION AND VENTILATION

INSULATION

Attic Insulation Fiberglass Loose

Approximate Depth "

VENTILATION

Ventilation Wall Vent

INFORMATION

Attic ventilation is critically important. During summer or humid months, inadequate attic ventilation can lead to roof degradation because of high temperatures or moisture. During winter or colder months, inadequate attic ventilation can lead to condensation, mold or mildew development, sheathing problems and indoor air quality problems.

Ice dam leaks occur in winter if a roof system is not properly ventilated and/or insulated. The situation usually occurs when outside temperatures are below freezing and the attic temperature is above freezing with snow on the roof. As snow melts, it runs down the roof, and then refreezes at the colder eaves, forming an ice dam, which backs up under the roof covering near the eaves. The general remedy to ice damming is to improve attic ventilation and/or insulation, the objectives of which are to provide proper air flow and to keep the attic and roof sheathing as cool as possible.

COMMENTS

Insulation and Ventilation - Attic Insulation



No issues noted.

Insulation and Ventilation - Basement Insulation

Not present.


Insulation and Ventilation - Crawl Space Insulation

Not present.

Insulation and Ventilation - Ventilation

No issues noted.

Insulation and Ventilation - Humidity Control





INTERIOR

INTERIOR

Carpeting, Wood, Ceramic Tile **Floors**

Drywall, Plaster Walls

Ceilings

Conventional Stairs/Steps Double Hung Windows Wood, Vinyl

FIREPLACE

Living Room Location Built-In Type Metal Materials

LIMITATIONS

Floors The floors cannot be properly inspected because a covering material (e.g.,

carpet, rug or other material) prevents unobstructed access. Therefore, the

inspection is limited.

Fireplace The fireplace is in use and, therefore, is not inspected.

INFORMATION

Insulated glass is comprised of two panes of glass with dry air or inert gas sealed between the panes. If a seal fails, air and moisture penetrate between the panes and, as temperatures vary, moisture vapors between the panes of glass turn to liquid and stain the inside of the glass. In most cases, staining is visible; however, it may be difficult to identify the impact of a seal failure in its early stages. Reflection of light also make failures difficult, or impossible, to identify. Although failed seals may incrementally impair insulating qualities of the glass, aesthetics generally is a more important concern. To resolve failed insulated glass seals, insulated glass units or the entire sash must be replaced. If there are any windows with failed insulated glass seals, carefully examine all other similar types of windows.

The cracks in the wall surfaces are typical. These are generally due to the shrinkage of lumber and/or normal settlement. Make cosmetic repairs before painting.

COMMENTS

Interior - Floors



No issues noted.



INTERIOR

Interior - Walls

M Issue

The interior wall shows some possible past water damaged. Testing with a moisture meter indicates low

moisture content (dry) at the time of this inspection. It maybe older and the wall. Wasn't patched.

Location Living Room

Action Monitor the wall near the front large window for water leaks.



Interior - Ceilings

✓ No issues noted.

Interior - Stairs/Steps

Issue There are loose steps. This is a safety issue.

Location Basement

Action Repair or replace the steps.



Interior - Cabinets



✓ No issues noted.



INTERIOR

Interior - Countertops

✓ No issues noted.

Interior - Doors

✓ No issues noted.

Interior - Windows

M Issue The window is painted/stuck shut in the bathroom.

Location Bathroom

Action Remove the paint to unstick the window.

Interior - Fireplace

✓ No issues noted.


Interior - Fireplace Damper

Not present.

Interior - Fireplace Doors/Screens

Not present.

Interior - Fuel-burning Appliances





ELECTRICAL

SERVICE

Source Overhead
Conductor Aluminum
Disconnect Circuit breaker
Disconnect Location Left side of home

Incoming Amperage 200 Meter Amperage 200

Grounding/Bonding Main panel

Water Service Pipe

PANEL

Main Circuit Breaker
Location Basement
Amperage 100

Voltage

DISTRIBUTION

Wiring Type(s) Non-metallic Sheathed Cable (Romex)

Wiring Material(s) Copper

OTHER

Smoke Detectors Not Present
Carbon Monoxide Detectors Present

LIMITATIONS

Smoke Detectors Smoke alarm(s) appears to be operational, i.e., the test button(s) works

when pushed. However, clients should note that this action only tests the battery of the unit(s). Testing of the actual smoke detector mechanism requires the use of smoke, which is outside the scope of this inspection. Smoke alarms which utilize batteries as either a primary or secondary power source should have the batteries replaced twice per year. The smoke detector mechanism of these alarms only has a life span of 10 years, requiring replacement of the entire smoke alarm after this time. When replaced, combination photo-electric and ionization units should be used to protect against smoldering fires and flaming fires, respectively. Alarms presently are being manufactured with enclosed 10 year batteries. This prevents frequent battery replacement and acts a reminder to replace the

entire alarm when the battery dies.

INFORMATION

The age of batteries in smoke detectors and carbon monoxide detectors is not evident; therefore, we recommend installation of new batteries upon occupancy of the home.

Please note that the function of photo-electrically controlled lights, motion detector devices, and those controlled by timers is beyond the scope of a home inspection.



ELECTRICAL

PHOTOS

Electrical - Service



Electrical - Panel



COMMENTS

Electrical - Service

✓ No issues noted.

Electrical - Panel

✓ No issues noted.

Electrical - Sub-Panel



ELECTRICAL

Electrical - Branch Circuits

There are missing junction box covers. This is a safety concern that defeats the box's fire rating and permits contact with energized components.

Location Basement

Action Hire a contractor to make required repairs.



Electrical - Grounding/Bonding



No issues noted.

Electrical - Receptacles



✓ No issues noted.

Electrical - Switches



✓ No issues noted.

Electrical - Fixtures



No issues noted.

Electrical - Smoke Detectors



There are missing smoke detectors. This is a safety issue. There should be at least one functional smoke detector on each level of the house.

Location Bedroom

Action Replace the smoke detector.

Electrical - CO Detectors



✓ No issues noted.



HEATING AND COOLING

HEATING SYSTEM

Heating System Basement

Type and Energy Source Furnace, Natural Gas

Age (Years) 14

Estimated Useful Life When New (Years) 18 to 20 Manufacturer Amana

COOLING SYSTEM

Cooling System Rear

Type and Energy Source Central Split, Electric

Age (Years) 20

Estimated Useful Life When New (Years) 15 to 18
Manufacturer Dayton

DISTRIBUTION

Distribution Ductwork

Is there a heat source in all living spaces? Yes

LIMITATIONS

Heating System Comprehensive evaluation of the heat exchanger is specifically excluded

from this inspection due to visibility and design limitations of forced-air furnaces. Comprehensive evaluation can only be obtained by dismantling or specialized testing, which is beyond the scope of this home inspection.

INFORMATION

HVAC manufacturers recommend replacement/cleaning of air filters at regular intervals; dirty filters restrict airflow, reduce efficiency, impair air quality, and reduce overall service life expectancy of HVAC equipment.

The full scope of the HVAC system's condition is not included in this report due to an independent specialist's evaluation. Refer to the specialist's report(s) for more information and required actions. Any observations are provided as a courtesy.

The cooling system is past the end of its useful life. We recommend establishing a budget to replace the cooling system.



HEATING AND COOLING

PHOTOS

HVAC - Cooling System



Heating System 1



Cooling System 1



COMMENTS

HVAC - Heating System

✓ No issues noted.

HVAC - Cooling System

The compressor coils are dirty. This can affect efficiency.

Location Rear

Hire an contractor to clean the coils. Action

HVAC - Distribution



✓ No issues noted.



HEATING AND COOLING

HVAC - Humidifier



Not present.

HVAC - Thermostat



✓ No issues noted.



PLUMBING

SUPPLY AND PIPES

Service Source Public
Service Pipe Lead
Water Pressure (psi) 72

Main Shut-off LocationBasementInterior Supply PipingCopperWaste SystemPublic

Drain/Waste/Vent Materials PVC, Cast Iron

WATER HEATER

Location Basement

Type Conventional Tank, Natural Gas

Age (Years) 14

Estimated Useful Life When New (Years) 10 to 20 Capacity (Gallons) 50

Manufacturer Whirlpool

LIMITATIONS

The inspector does not operate or test shut-off valves.

The inspector does not fill sinks, bathtubs, or showers to test the function of overflow drains.

Supply Pipes Restricted access limits the inspection of plumbing piping and fixtures.

Drain, Waste, Vents Restricted access limits the inspection of plumbing piping and fixtures.

INFORMATION

Visible, accessible portions of supply and drain lines are inspected; however, most supply and drain lines are not visible and, therefore, can't be visually inspected.

Check drainage at all plumbing fixtures and associated appliances during pre-settlement walk-through. Recommended hot water temperature is approximately 120 °F or lower.

The water line is half I ch and may restrict flow. Consider adding updated 3/4 inch copper line.

A video drain line inspection can reveal hidden problems, including issues in the main drain that connects to the municipal sewer. Consider a video drain line inspection to determine if there are additional concerns that cant be detected within the scope of a home inspection.



PLUMBING

PHOTOS

Shut-off Valve



Water Heater



COMMENTS

Plumbing - Service

✓ No issues noted.


Plumbing - Main Shut-off

✓ No issues noted.

Plumbing - Supply Pipes

Issue The water supply pipe is corroded. This can cause damage and leaks.

Location Basement near electric panel.
Action Hire a plumber to replace the pipe.

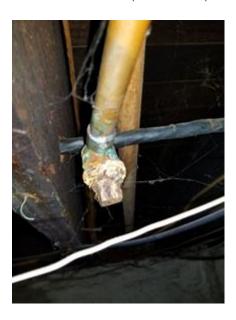



PLUMBING

Plumbing - Drain, Waste, Vents

✓ No issues noted.

Plumbing - Toilet

🚺 Issue The toilet base is loose at the floor. This permits leaks and causes water damage to surrounding areas.

Location Bathroom

Action Re-secure the toilet to the flooring after replacing the wax ring.

Plumbing - Tub/Shower


✓ No issues noted.

Plumbing - Sink

Issue The sink drain is leaking. This can allow water damage.

Location Bathroom

Action Repair or replace the drain.

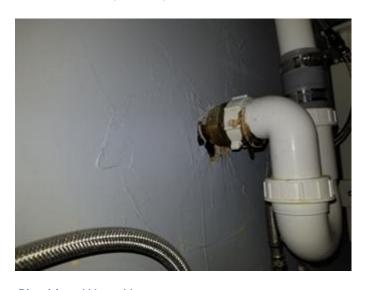

Plumbing - Water Heater

✓ No issues noted.

Plumbing - Whirlpool Tub

Not present.

Plumbing - Hose Faucet



FUEL SERVICES

FUEL SERVICES

Meter Basement

PHOTOS

Shut-off Valve



COMMENTS

Fuel Services - Tanks



Fuel Services - Meter

✓ No issues noted.



APPLIANCES

KITCHEN

Range/Oven

Electric Free-Standing

Microwave

Dishwasher

INFORMATION

Clean dryer vents at regular intervals. Ductwork should be rigid material and as short and straight as possible. If ductwork extensions are required, sections should be taped together as opposed to connected with screws to ensure that lint does not collect on any screw points. If clothing requires an unusually long time to dry, or if airflow is weak at the exhaust end of the duct, the vent may be clogged. Dryer fires are not uncommon and dryer vent restriction is one cause of dryer fires.

COMMENTS

Appliances - Range/Oven



No issues noted.

Appliances - Oven



Not present.

Appliances - Microwave



✓ No issues noted.

Appliances - Cooktop



Not present.

Appliances - Garbage Disposal



✓ No issues noted.

Appliances - Dishwasher



✓ No issues noted.

Appliances - Refrigerator/Freezer



Not present.

Appliances - Other Built-ins

Not present.

Appliances - Ventilation System

Not present.

Appliances - Washer

Not present.

Appliances - Dryer




Exclusive Offer for US Inspect's Customers and Realtors

FIRST SHIPMENT FREE

for all US Inspect Customers and Realtors!

Air filters delivered when it's time to change them.

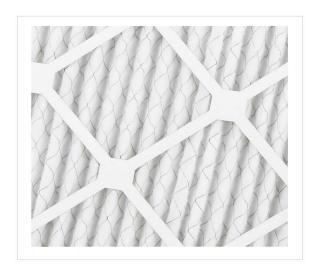

How many filters does the home have?

1
What size filters does the home need?

16x25x1

www.filtereasy.com/usinspect

Why wait to move in?!
You probably need to change *your* home's filters!



SEASONAL MAINTENANCE CHECKLIST

Please contact your Realtor if you would like this checklist in card format; instruct your Realtor to contact us at marketing@usinspect.com.



One benefit of summer was that each day we had more light to read by.

- Jeannette Walls, The Glass Castle -

INTERIOR

- O Change your icemaker filter
- Catch some rays while cleaning your windows
- Clean and lubricate your window channels
- Search for mold (gray or black blotches)

INSULATION AND VENTILATION

- Clean and test your dehumidifier
- Check your attic for proper insulation
- Clean your dryer vent
- Check vents for birds, squirrels, or other pests

ELECTRICAL SYSTEMS

- Check your wiring and cables for wear and damage
- Test and reset your GFCI and AFCI outlets/breakers

HVAC

- Change your filters
- Hire an HVAC contractor to service your system

PLUMBING

- Check all fixtures for leaks
- Check tile joints, grout and caulking
- O Clean your exterior drains, e.g. stairwell
- Get your drinking water tested (well potability)

• SUMMER • Maintenance Checklist

EXTERIOR

- Check the house for loose or rotted siding
- Check your deck for popped nails or loose treads
- Reseal your driveway
- Inspect and clean your grill
- Fill cracks in your patio and sidewalks

ROOF

- Check your roof for damage or missing shingles
- Trim branches and trees away from the roof

STRUCTURE

- Reseal your garage floor
- Keep fertilizer/power tools out of children's reach
- Check your crawl space for moisture
- Remove combustible materials from the garage

WATER CONTROL

- O Pour water into your sump to test the pump
- Clean your gutters and window wells
- Extend downspouts away from your foundation
- Make sure grading flows water away

FUEL SERVICES

Check your gas/oil tank for odors and leaks

PROPERTY

- Trim shrubs and plants away from HVAC units
- Check your property for pests ants, termites, bees
- Save energy install a clothesline!



888.USINSPECT

www.usinspect.com





LIFE EXPECTANCIES OF RESIDENTIAL SYSTEMS AND COMPONENTS

Please contact your Realtor if you would like this checklist in card format; instruct your Realtor to contact us at marketing@usinspect.com.



EXTERIOR		HV
ROOF COVERING		HE
Fiberglass/asphalt 3-tab	16-20	Нс
Fiberglass architectural	25-35	Во
Cedar shake/shingle	10-30	He
Slate	50+	Ele
Synthetic slate	NA	In-
Metal standing/seams	50-80	Regi
Clay/concrete tiles	50-80+	esse
Single ply modified bitumen	16-20	for r
EPĎM/ŤPO/PVC	20-24	syst
Affected by installation procedures,		CO
exposure, and regular recoating.		Ce
Coverings facing south wear more		He
quickly. Slate affected by hardness	las r	Eva
and quarry source. Cedar affected wood quality and maintenance.	DУ	Regi
Tin roofs will remain functional if		esse
recoated every 3-5 years.		OT
SIDING AND VENEER		Cir
Cement composite	50+	Cir
Vinyl	35+	Fu
Aluminum	50+	Fu
Hardboard/composite	20-30	Exp
Stucco, brick, veneers	Lifetime	Ηú
Affected by finish, exposure to sun,		WE
and maintenance. Repoint masonr	/	Sul
as required.		Ab
GUTTER/DOWNSPOUT		Ste
Aluminum	30+	SEF
Galvanized	15-25	St
Copper	50-80	Co
Plastic (PVC)	15-25	Le
Affected by slope and maintenance	2.	Sept
DECK		lifesi
Wood	15-25	and
Composite materials	25-35	espe
Affected by moisture, climate and		on-s
maintenance.		Impi

	HVAC	
+	HEATING SYSTEM Hot air furnace (oil/gas) Boiler Heat pump Electric baseboard In-floor radiant (electric) Regular service and cleaning is essential for all systems (except for radiant); critical for oil-fired systems.	15-25 35-50 10-15 15-25 15-25
	COOLING SYSTEM Central split-system Heat pump Evaporative cooler Regular service and cleaning is essential.	10-15 10-15 10-15
ne	OTHER COMPONENTS Circulator pump Circulator fan Fuel tank (interior) Fuel tank (exterior) Expansion tank (bladder) Humidifier	20-30 15-20 50-80+ 30-50 15-25 7-10
	WELL Submersible pump Above ground pump Steel pressure tank	15-20 15-20 15-25
	SEPTIC Steel tank Concrete tank Leach field	15-20 30-50 30-50
	Septic system performance and lifespan are dependent on regulc and qualified maintenance; this especially true of "engineered" on-site treatment systems. Improper use, improper parking evehicles, and inappropriate plantings will negatively affect a sentic system.	İs



a septic system.

Schedule Your Inspection

888.USINSPECT

www.usinspect.com



Lye	.xpn	econcres	
PLUMBING		APPLIANCES	
Affected by water quality and		Refrigerator	15-20
quality of installation. Fixtures		Dishwasher	7-12
may require new cartridges and seals; toilets may require new		Range/cooktop	12-20
internal parts.		Garbage disposal	7-12
Water Service (Public)		Microwave oven	7-12
Lead	75-10	Washer	7-12
Galvanized steel	40-60	Dryer	10-15
Copper	75+	INTERIOR	
Plastic	NA	Ceramic Tile	
Interior Water Pipes		Mud-set, cement board	Lifetime
Galvanized steel	40-60	Mastic (adhesive)	15-25
Copper	75+	Plaster wall/ceiling	Lifetime
Plastic	NA	Drywall wall/ceiling	Lifetime
Drainage Line		Flooring	
Galvanized steel	40-60	Wood (solid)	Lifetime
Copper	50-75	Wood (engineered)	50+
Cast iron	60-90	Laminate -	15-25
ABS/PVC	30-50+	Sheetgoods (linoleum)	10-15
Water Heater		Granite/marble	100+
Tank water heater	10-15	Carpet	7-12
Tankless water heater	15-20	WINDOWS	
In-boiler domestic coil	15-20	Wood	50-80+
Tankless water heaters generally		Vinyl	25+
require servicing every other		Aluminum/steel	35-50+
year.		Functionality of wood and	
Fixtures		metal windows affected by	
Builder's grade	15-20	regular maintenance. Quality	
Higher quality	00.50	of vinyl products varies	
Faucet, fixture Sink, toilet, tub	30-50	substantially. Insulated glass likely will require replacement.	
, ,	Lifetime	ilkely will require replacement.	
ELECTRICAL			
Service entrance cable	25-40		
Sheathing condition affected by			
exposure/sun.			
Circuit breaker/fuse panel	Lifetime		
Wiring (modern Romex)	Lifetime		
Wiring (armored/cloth)	60-80		
Wiring (knob and tube)	75-90		
Affected by use, modifications,			

In three words, I can sum up everything I've learned about life: It goes on.

- Robert Frost -

Schedule Your Inspection

888.USINSPECT

and adjacent activity.

www.usinspect.com